

WX5600-T0 Generic

Firmware Release Note

V5.70(ACEB.6)C0

Date: MAR 12, 2026

Author: Linda Huang

Reviewer:

THIS DOCUMENT CONTAINS PROPRIETARY TECHNICAL INFORMATION THAT IS THE PROPERTY OF THE Zyxel AND SHOULD NOT BE DISCLOSED TO OTHERS IN WHOLE OR IN PART, REPRODUCED, COPIED, OR USED AS BASIS FOR DESIGN, MANUFACTURING OR SALE OF APPARATUS WITHOUT WRITTEN PERMISSION OF Zyxel.

TABLE OF CONTENTS

SUPPORTED PLATFORMS:.....	6
VERSIONS:	6
NOTES:.....	6
KNOWN ISSUES.....	10
MODIFICATIONS IN 5.70(ACEB.6)C0.....	10
MODIFICATIONS IN 5.70(ACEB.6)B3.....	10
MODIFICATIONS IN 5.70(ACEB.6)B2.....	10
MODIFICATIONS IN 5.70(ACEB.6)B1	11
MODIFICATIONS IN 5.70(ACEB.5)C0.....	12
MODIFICATIONS IN 5.70(ACEB.5)B4.....	13
MODIFICATIONS IN 5.70(ACEB.5)B3.....	13
MODIFICATIONS IN 5.70(ACEB.5)B2.....	14
MODIFICATIONS IN 5.70(ACEB.5)B1	18
MODIFICATIONS IN 5.70(ACEB.4.1)B2	19
MODIFICATIONS IN 5.70(ACEB.4.1)B1	20
MODIFICATIONS IN 5.70(ACEB.4)C0.....	21
MODIFICATIONS IN 5.70(ACEB.4)B3.....	21
MODIFICATIONS IN 5.70(ACEB.4)B2.....	22
MODIFICATIONS IN 5.70(ACEB.4)B1	23
MODIFICATIONS IN 5.70(ACEB.3.2)C0.....	25
MODIFICATIONS IN 5.70(ACEB.3.2)B1	25
MODIFICATIONS IN 5.70(ACEB.3.1)C0.....	26
MODIFICATIONS IN 5.70(ACEB.3.1)B1	27
MODIFICATIONS IN 5.70(ACEB.3)C0.....	27
MODIFICATIONS IN 5.70(ACEB.3)B5.....	28
MODIFICATIONS IN 5.70(ACEB.3)B4.....	29

MODIFICATIONS IN 5.70(ACEB.3)B3.....	29
MODIFICATIONS IN 5.70(ACEB.3)B2.....	30
MODIFICATIONS IN 5.70(ACEB.3)B1.....	32
MODIFICATIONS IN 5.70(ACEB.2)C0.....	34
MODIFICATIONS IN 5.70(ACEB.2)B5.....	34
MODIFICATIONS IN 5.70(ACEB.2)B4.....	34
MODIFICATIONS IN 5.70(ACEB.2)B3.....	35
MODIFICATIONS IN 5.70(ACEB.2)B2.....	35
MODIFICATIONS IN 5.70(ACEB.2)B1.....	37
MODIFICATIONS IN 5.70(ACEB.1)C0.....	38
MODIFICATIONS IN 5.70(ACEB.1)B3.....	38
MODIFICATIONS IN 5.70(ACEB.1)B2.....	39
MODIFICATIONS IN 5.70(ACEB.1)B1.....	39
MODIFICATIONS IN 5.70(ACEB.0)C0.....	40
MODIFICATIONS IN 5.70(ACEB.0)B5.....	40
MODIFICATIONS IN 5.70(ACEB.0)B4.....	41
MODIFICATIONS IN 5.70(ACEB.0)B3.....	41
MODIFICATIONS IN 5.70(ACEB.0)B2.....	42
MODIFICATIONS IN 5.70(ACEB.0)B1.....	44

Revision History

Date	Release	Author	Description
2022/04/06	1.0	Yumi Wu	FW release for V5.70(ACEB.0)b1
2022/05/12	1.1	Yumi Wu	FW release for V5.70(ACEB.0)b2
2022/06/02	1.2	Yumi Wu	FW release for V5.70(ACEB.0)b3
2022/06/22	1.3	Yumi Wu	FW release for V5.70(ACEB.0)b4
2022/07/29	1.4	Yumi Wu	FW release for V5.70(ACEB.0)b5
2022/08/17	1.5	Yumi Wu	FW release for V5.70(ACEB.0)C0
2022/09/27	2.0	Yumi Wu	FW release for V5.70(ACEB.1)b1
2022/11/04	2.1	Yumi Wu	FW release for V5.70(ACEB.1)b2
2022/11/21	2.2	Yumi Wu	FW release for V5.70(ACEB.1)b3
2022/12/09	2.3	Yumi Wu	FW release for V5.70(ACEB.1)C0
2023/02/24	3.0	Yumi Wu	FW release for V5.70(ACEB.2)b1
2023/04/28	3.1	Yumi Wu	FW release for V5.70(ACEB.2)b2
2023/06/16	3.2	Yumi Wu	FW release for V5.70(ACEB.2)b3
2023/08/02	3.3	Frank Chang	FW release for V5.70(ACEB.2)b4
2023/09/01	3.4	Frank Chang	FW release for V5.70(ACEB.2)b5
2023/09/18	3.5	Frank Chang	FW release for V5.70(ACEB.2)C0
2023/10/20	3.6	Frank Chang	FW release for V5.70(ACEB.3)b1
2023/12/15	3.7	Frank Chang	FW release for V5.70(ACEB.3)b2
2024/3/1	3.8	Frank Chang	FW release for V5.70(ACEB.3)b3
2024/4/3	3.9	Frank Chang	FW release for V5.70(ACEB.3)b4
2024/4/19	3.10	Frank Chang	FW release for V5.70(ACEB.3)b5
2024/4/24	3.11	Frank Chang	FW release for V5.70(ACEB.3)C0
2024/5/29	3.12	Frank Chang	FW release for V5.70(ACEB.3.1)b1
2024/5/30	3.13	Frank Chang	FW release for V5.70(ACEB.3.1)C0
2024/7/5	3.14	Frank Chang	FW release for V5.70(ACEB.3.2)b1
2024/7/5	3.15	Frank Chang	FW release for V5.70(ACEB.3.2)C0
2024/7/31	3.16	Frank Chang	FW release for V5.70(ACEB.4)b1
2024/11/1	3.17	Frank Chang	FW release for V5.70(ACEB.4)b2
2025/1/3	3.18	Frank Chang	FW release for V5.70(ACEB.4)b3
2025/2/25	3.19	Frank Chang	FW release for V5.70(ACEB.4)C0
2025/4/2	3.20	Frank Chang	FW release for V5.70(ACEB.4.1)b1

2025/5/9	3.21	Frank Chang	FW release for V5.70(ACEB.4.1)b2
2025/5/20	3.22	Frank Chang	FW release for V5.70(ACEB.5)b1
2025/7/11	3.23	Frank Chang	FW release for V5.70(ACEB.5)b2
2025/9/4	3.24	Mickey Hsu	FW release for V5.70(ACEB.5)b3
2025/10/3	3.25	Mickey Hsu	FW release for V5.70(ACEB.5)b4
2025/10/23	3.26	Mickey Hsu	FW release for V5.70(ACEB.5)C0
2025/11/28	3.27	Mickey Hsu	FW release for V5.70(ACEB.6)b1
2026/01/29	3.28	Linda Huang	FW release for V5.70(ACEB.6)b2
2026/03/12	3.29	Linda Huang	FW release for V5.70(ACEB.6)b3
2026/03/12	3.30	Linda Huang	FW release for V5.70(ACEB.6)C0

WX5600-T0 Generic V5.70(ACEB.6)C0 Release Note

Date: MAR 12, 2026

Supported Platforms:

Zyxel WX5600-T0

Versions:

Bootbase version : V3.1 | 01/03/2025 13:45:19

Firmware version : V5.70(ACEB.6)C0

Kernel version: 5.4.171

WLAN code version: 7.6.2.5

Notes:

Public Domain Software Announcements

Open Source Used (3rd party software)	Version	From (Source)	Licensing Term	Modified / Used
atftp	0.8.0	https://sourceforge.net/projects/atftp/	gpl-2.0-only	Modified
attr	2.4.48	http://savannah.nongnu.org/projects/attr	gpl-2.0-only	Used
bridge-utils	1.7	http://www.linuxfromscratch.org/blfs/view/svn/basicnet/bridge-utils.html	gpl-2.0-only	Modified
busybox	1.31.1	https://busybox.net/	gpl-2.0-only	Modified
clinkc	2.4	https://sourceforge.net/projects/clinkc/	bsd-3-clause	Modified
conntrack-tools	1.4.6	https://git.netfilter.org/conntrack-tools/	gpl-2.0-only	Used
dropbear	2024.85	https://github.com/mkj/dropbear	MIT	Modified
ebtables	2018-06-27-48cff25d	https://git.netfilter.org/ebtables/	gpl-2.0-only	Modified
eventlog	0.2.10	https://github.com/balabit/eventlog	bsd-3-clause	Used
expat	2.7.1	https://github.com/libexpat/libexpat	MIT	Used
gettext	0.19.8.1	http://www.gnu.org/software/gettext/	gpl-3.0-only	Used
glib	2.68.4	http://www.gtk.org/	lgpl-2.1-only	Used
iproute2	5.11.0	https://github.com/shemminger/iproute2	gpl-2.0-only	Modified
iptables	1.8.7	https://git.netfilter.org/iptables/	gpl-2.0-only	Modified
json-c	0.15	https://github.com/json-c/json-c/downloads	MIT	Modified
libedit	20210419-3.1	http://pkgs.fedoraproject.org/repo/pkgs/libedit/libedit-20080712-2.11.tar.gz/	BSD-3-Clause	Modified
libffi	3.3	http://pkgs.fedoraproject.org/repo/pkgs/libffi/libffi-3.0.11.tar.gz/	MIT	Used
libiconv	1.16	https://ftp.gnu.org/gnu/libiconv/libiconv-1.16.tar.gz	lgpl-2.0-only	Modified
libmnl	1.0.4	http://www.netfilter.org/projects/libmnl/	lgpl-2.1-only	Modified
libnetfilter_conntrack	1.0.8	https://git.netfilter.org/libnetfilter_conntrack/	gpl-2.0-only	Used
libnetfilter-cthelper	1.0.0	http://www.netfilter.org/projects/libnetfilter_cthelper/	gpl-2.0-only	Used

elper				
libnetfilter_ctt imeout	1.0.0	http://www.netfilter.org/projects/libnetfilter_cttimeout/	gpl-2.0-only	Used
libnetfilter_qu eue	1.0.5	https://git.netfilter.org/libnetfilter_queue/	gpl-2.0-only	Used
libnfnetlink	1.0.1	https://git.netfilter.org/libnfnetlink/	gpl-2.0-only	Used
libnl	3.5.0	http://www.infradead.org/~tgr/libnl/	lgpl-2.1-only	Modified
libnl-tiny	2020-08-05-c 291088f	https://github.com/openwrt/openwrt/tree/master/package/libs/libnl-tiny	lgpl-2.1-only	Modified
libpcap	1.9.1	www.tcpdump.org	BSD-3-Clause	Used
libselenium	3.2	https://github.com/SELinuxProject/selinux/releases/download/3.2	Public-Domain	Used
libsepol	3.2	https://github.com/SELinuxProject/selinux/releases/download/3.2	lgpl-2.1-only	Used
libsrt	1.6.0	http://oss.metaparadigm.com/json-c/	BSD-3-Clause	Modified
libstrophe	0.12.2	https://code.load.github.com/strophe/libstrophe/tar.gz/	gpl-3.0-only	Modified
libtool	2.4.6	http://www.gnu.org/software/libtool/	gpl-2.0-only	Used
libubox	2021-05-16-b 14c4688	http://mirror.greenwavereality.com/openwrt/	ISC	Used
libxml2	2.14.3	http://xmlsoft.org/sources/	MIT	Used
Linux/Arm Kernel	5.4.171	http://ftp.ntu.edu.tw/pub/linux/kernel/v5.x/	gpl-2.0-only	Modified
logrotate	3.22.0	https://launchpad.net/ubuntu/hardy/i386/logrotate/	gpl-2.0-only	Modified
mailsend	1.19	https://github.com/muquit/mailsend/	BSD-3-Clause	Modified
ncurses	6.2	http://ftp.gnu.org/pub/gnu/ncurses/	MIT	Modified
net-snmp	5.9.4	http://www.net-snmp.org/	BSD-3-Clause	Modified
ntpclient	2015	http://doolittle.icarus.com/ntpclient/	gpl-2.0-only	Modified
openssl	3.5.0	http://www.openssl.org	OpenSSL	Modified
popt	1.16	http://rpm5.org/files/popt/	MIT	Modified
readline	8.2	http://cnswww.cns.cwru.edu/php/chet/readline/rltop.html	gpl-3.0-only	Used
sqlite	3500100	http://www.sqlite.org/	Public-Domain	Used
syslog-ng	4.7.1	https://github.com/balabit/syslog-ng	gpl-2.0-only	Used

tcpdump	4.99.3	http://www.tcpdump.org/	bsd-3-clause	Used
udhcp	0.9.8	http://udhcp.busybox.net/	gpl-2.0-only	Modified
util-linux	2.36.1	https://github.com/karelzak/util-linux/	gpl-2.0-only	Used
wide-dhcpv6	20080615	https://sourceforge.net/projects/wide-dhcpv6/	bsd-3-clause	Modified
zlib	1.3.1	https://github.com/madler/zlib	zlib	Used

Known issues

Modules	Issue	Risk Impact Information

Modifications in 5.70(ACEB.6)C0

Based on V5.70(ACEB.6)b3 to release V5.70(ACEB.6)C0

Modifications in 5.70(ACEB.6)b3

● Feature Enhancement

Modified Modules	Features Enhancement List
	1.

● Bug Fixed

Modified Modules	Bug Fixed List
	1. [#250177][CVE-2026-1460][Zyxel-SI-1653][Vulnerability] post-authentication command injection vulnerability in the DomainName parameter of the DHCP configuration file

Modifications in 5.70(ACEB.6)b2

● Feature Enhancement

Modified Modules	Features Enhancement List
GUI	2. [#247320][GUI] GUI configurable element
System	1. [#247424] OPENSSL and other packages updated

● Bug Fixed

Modified Modules	Bug Fixed List

Wireless	<ol style="list-style-type: none"> [#246510][WLAN] Can't change Security Mode to WPA3-SAE in Wireless General page. [#246545][WLAN] WX5600-T0 is Repeater mode disable mesh and use WPS HW or SW PBC or AP list to connect AP can't work.
System	<ol style="list-style-type: none"> [#236920] CDRouter [20250619021843] usp_28: Notifications - Subscription Expiration is failed [#245207][eITS#251100611]Unable to adjust parameter values from ACS and obuspa Device.X_ZYXEL_LoginCfg.LogGp.i.Account.i.
Security	<ol style="list-style-type: none"> [#249023] Zyxel-SI-1650 [Vulnerability] Post-authentication command injection vulnerabilities in the EasyMesh related APIs

Modifications in 5.70(ACEB.6)b1

● Feature Enhancement

Modified Modules	Features Enhancement List
GUI	<ol style="list-style-type: none"> [#243090] [eITS#250700232] Change Wireless and Wire MAC filter in the same page [#243109] [eITS#250501383] Request more user friendly information in Steering Status GUI view [#244341] [eITS#251000050]OPAL, Under Steering Status View in GUI, change column name for Station Band [#244772] [eITS#250700231] Change Wireless and Wire MAC filter in the same page
Wireless	<ol style="list-style-type: none"> [#244788] [eITS#250401065] [Security] WPA Password rule change
System	<ol style="list-style-type: none"> [#245669] [Feature] Hotspot backup
APP	<ol style="list-style-type: none"> [#245747] [Feature] FW includes Cloud CA for Zyxel One App

● Bug Fixed

Modified Modules	Bug Fixed List
ACTS	1. [#224641] [ACTS] [MPro Mesh] Random auto config fail, RP_Agent cannot get wifi setting normally
GUI	1. [#241541] [GUI-Topology] The device icon on the topology page didn't update according to the list settings. 2. [#243248] [Mpro Mesh][GUI-Connectivity] Wi-Fi client's band info shows "24G" when it connects to the Controller's 2.4G band. 3. [#243459] [GUI] Connectivity List page can't display correct client info.
System	1. [#244775] [eITS#251100043] ROMD supports "ISP Logo" strings exceeding 4095 characters 2. [#245577] [eITS#251101455]Error in setting string values with obuspa, \u0000 ending added to cfg file
Security	1. [#245640] [CVE-2025-11845, CVE-2025-11846, CVE-2025-11847, CVE-2025-11848] Zyxel-SI-1638 [Vulnerability] Multiple potential null pointer dereference vulnerabilities in the CGI program

Modifications in 5.70(ACEB.5)C0

Based on V5.70(ACEB.5)b4 to release V5.70(ACEB. 5)C0

● Feature Enhancement

Modified Modules	Features Enhancement List

● Bug Fixed

Modified Modules	Bug Fixed List

Modifications in 5.70(ACEB.5)b4

● Feature Enhancement

Modified Modules	Features Enhancement List
System	1. [#243035] [eITS#251000156] WX5600, Unisolated Guest SSID option

● Bug Fixed

Modified Modules	Bug Fixed List
Wireless	1. [#236798] [WLAN] In 學禮樓 environment, 2.4G clinet will steering to 5G success 2. [#243019] [eITS#250901423] softIRQ issue (cont.)
WLAN	1. [#238340] [ACTS][WLAN][TR181] WiFi.AccessPoint.1.Security.ModesSupported Should not include WEP-64 & WEP128
GUI	1. [#241346] [GUI-Wireless] Login GUI with "admin" account first. WMM / Others / MAC Authentication pages do not respond when clicked. 2. [#241541] [GUI-Topology] The device icon on the topology page didn't update according to the list settings.
TR-369	1. [#242932] remove Parking server USP config in Ex5601 and WX5600 generic release FW.

Modifications in 5.70(ACEB.5)b3

● Feature Enhancement

Modified Modules	Features Enhancement List
System	2. [#240797] [eITS#250700234] Support for optional Traffic Separated SSIDs 3. [#240947] [eITS#250401446] Feature request to add easy

	Mesh Reboot option from cli
GUI	1. [#240962] [eITS#250601863] Use the term Wi-Fi instead of wifi in the GUI

● Bug Fixed

Modified Modules	Bug Fixed List
System	3. [#200849] [System] After modify backup configure, can not login admin with the new password
WPS	2. [#218182] [WPS] WPS doesn't work actually even countdown is running when do instinct operating.
GUI	1. [#238248] [System]Hostname not support special character should be clarify
MPro Mesh	1. [#238557] [MPro Mesh][Zyxel One_Agent] After do add extender via RP_Agent finished but the connection type is show wrong. 2. [#238680] [MPro Mesh][Zyxel One_Agent] In cloud base, APP can't display second layer Extender and wifi clients. (Once time)

Modifications in 5.70(ACEB.5)b2

● Feature Enhancement

Modified Modules	Features Enhancement List
System	2. [#233882] [Feature] Host Mana 3. [#233880] [Feature] Host Mana 4. [#233849] #17 [Project profile][Config] Enable data element hosts profile config cloud agent flag
TR-069	1. [#230048] add 2 TR-181 parameter to monitor the current CRC error rate on the 2 Ethernet ports

● Bug Fixed

Modified Modules	Bug Fixed List
System	<ol style="list-style-type: none"> 3. [#236789] [ZYXCPE-129] SoftwareVersion information of WX5600-T0 is not reported in Hosts object 4. [#236788] [ZYXCPE-128] SoftwareVersion is not reported under Hosts object 5. [#236787] [ZYXCPE-127] PHY rate unit is reported as Kbps instead of Mbps 6. [#236786] [ZYXCPE-126] RSSI is reported as 0 for WX5600 extender 7. [#236785] [ZYXCPE-121] DataElements object is not reported in 4.1b2 firmware 8. [#236784] [ZYXCPE-118] No whitespace in "IEEE 802.3u(IEEE 802.3u Fast Ethernet)" BackhaulMediaType 9. [#236783] [ZYXCPE-108] Serial Number and Software Version are not reported under DataElements 10. [#222559] [System] Modify hostname with space but it keep previous name 11. [#226451] [eITS#241201043][Lightning Fibre] / XMPP disabled after FW upgrade
TR369	<ol style="list-style-type: none"> 1. [#234349] [ACTS][Mpro Mesh][TR-369] Fail to check event log 2. [#201012] [TR-369] TR-369 should support lifemote script. 3. [#201009] [TR-369] Should support Neighboring WiFi Diagnostics command 4. [#201006] [TR-369] TR-369 should support TraceRouteDiagnostics command. 5. [#201000] [TR-369] TR-369 should support Command "Device.IP.Diagnostics.UploadDiagnostics()" & "Device.IP.Diagnostics.DownloadDiagnostics()". 6. [#200998] [TR-369] Set WPA3 Security Mode, TR-181 & USP standard parameter is SAEPassphrase not KeyPassphrase. 7. [#224858] [TR-369] While TR-369 Local Agent -> General is enable, add MQTT rule. GUI display incorrect. 8. [#201010] [TR-369] TR-369 should support CA option.

	<p>9. [#218238] [TR369] Setup Static IP ,IP is correct IP but GUI still show dhcp.</p> <p>10. [#236938] [TR369] Delete default websocket controller pop up warning message</p> <p>11. [#228259] [TR369] Delete MQTT controller pop up warning message</p>
Security	<p>1. [#235617] [CVE-2024-8176] Zyxel-SI-1605 [Vulnerability] The libexpat open source library is vulnerable to DoS attacks through stack overflow</p>
ACTS	<p>1. [#228945] [ACTS][WLAN] Romfile WPS PIN is not ciphertext</p> <p>2. [#224643] [ACTS] [MPro Mesh] Reboot GW via HW button, Node_D cannot get IP (random)</p> <p>3. [#224641] [ACTS] [MPro Mesh] Random auto config fail, RP_Agent cannot get wifi setting normally</p> <p>4. [#186438] [MPro Mesh_ACTS] In Mesh ACTS environment, sometimes onboarding fail: RP_Agent always keep default ip 192.168.1.2 after run wps commnad over 188 second</p> <p>5. [#228957] [ACTS][WLAN] Romfile setup channel skipped, DUT happen call trace</p>
MPro Mesh	<p>1. [#228341] [MPro Mesh]The WX5600 will fail the first time when switching the AP agent to the RP agent.</p> <p>2. [#224903] [MPro Mesh][Zyxel One_Agent] After change guest isolation level External/Home Guest, all agent should sync with Controller.</p> <p>3. [#190391] [MPro Mesh] After RP_Agent Onboarding and auto configure success, but WX5600 will disconnect and connect again.</p> <p>4. [#235358] [MPro Mesh][Zyxel One_Agent] Login APP is always fail when add AP/RP_Agent via Ethernet or wifi then rename AP/RP_Agent press "Next", APP will keep loading then pop up something wrong message.</p> <p>5. [#235285] [MPro Mesh][Zyxel One_Agent for Cloud] Do Add Extender fail via Zyxel One cloud APP.</p> <p>6. [#235221] [MPro Mesh][Zyxel One_Lifemote]For kit mode, WX5600_Controller sometimes will disconnect Lifemote</p>

	<p>server via APP (rate : 10%)</p> <ol style="list-style-type: none"> [#228129] [MPro Mesh]The WX5600 will fail the first time when switching the AP agent to the RP agent. [#224899] [MPro Mesh][Zyxel One_Agent] Enable Guest 2.4/5G or modify guest SSID and PW via APP, it will lead Controller p1905_managerd disapper. (rate:1/5) [#195983] [MPro Mesh] The connectivity page show solid line between Nonmesh GW and RPC. [#208354] [eITS#240101619][Eye Networks] WX5600, SSID not synchronized correctly in mesh where 2.4GHz radio is disabled
GUI	<ol style="list-style-type: none"> [#237015] [GUI] One SSID button description message display exception [#228185] [GUI] When is set LAN IP range with additional zeros e.g. 192.168.008.1, LAN DHCP will not work [#236879] [WLAN] The WLAN Station Status page shows an incorrect message in the Wireless Client GUI "Connection Uptime" column [#237019] [System] New wifi password does not follow the rules but can still be changed successfully
TR-069	<ol style="list-style-type: none"> [#230273] [eITS#250301288][Eye Networks] WX5600, LAN1/2 link values mixed up in TR069 output [#218431] [TR-069] LAN Ethernet Port index doesn't correspond with GUI defined. [#218775] [XMPP] If set with Special Characters for SSID will let CPE hangout.(random) [#218717] [XMPP] XMPP doesn't support Hosts.Host.3.
CD-Router	<ol style="list-style-type: none"> [#223294] CDRouter [20241113015915] usp_11: Get Message - Parameter Path Only is failed
DST	<ol style="list-style-type: none"> [#222741] [DST] DUT some functions and doesn't match with DST
Document	<ol style="list-style-type: none"> [#236853] [System] OpenSSL and Dropbear version should match with release note

Modifications in 5.70(ACEB.5)b1

● Feature Enhancement

Modified Modules	Features Enhancement List
System	<ol style="list-style-type: none"> 1. [#234464] [eITS#240401289] system log for OOM killer (Out Of Memory Killer) 2. [#233859] [Feature] Timezone Auto Detect 3. [#234689] [eITS#250200287] add 'screen' utility to FW 4. [#234470] [Feature] Timezone Auto Detect parameter in RESTful API 5. [#234459] [eITS#250100964] Support ROM-D defined GUI change password rule
APP	<ol style="list-style-type: none"> 1. [#234643] Zyxel one over Wi-Fi OPAL 2.0 RESTful API implementation 2. [#234468] [Feature] Follow RESTful API, add APPUICustomization Parameters 3. [#234466] #16 [Feature] Extend local APP session timeout time 4. [#234462] ZYXEL One Cloud support 5. [#234280] [Feature] FW includes Cloud CA for Zyxel One App
Security	<ol style="list-style-type: none"> 1. [#233877] [Feature] Parental Control Overnight feature
TR369	<ol style="list-style-type: none"> 1. [#233864] [Feature] Lifmote customization parameters for meminfo 2. [#233844] Zyxel certificate for OneCloud services 3. [#233838] [Enhance] TR369 Certificate 4. [#233161] "[Config] Lifmote default controller setting" 5. [#234467] [Feature] Support cloud agent flag in RESTful API
GUI	<ol style="list-style-type: none"> 1. [#234690] [eITS#250100038] Implement Wi-Fi SSID Split while Mesh is active from CPE GUI 2. [#234469] #13_Block special character in the account user name field

	<ol style="list-style-type: none"> [#234465] [eITS#241200053] Change values of Traffic Status from Byte to MB or GB [#234463] [eITS#240900420] Explain pictographic explanation of Guest Access Scenario [#231324] Mesh is enabled by default and is not configurable in the GUI.
MPro Mesh	<ol style="list-style-type: none"> [#234461] [eITS#230701179] Synchronize X_ZYXEL_CountryInBeacon values in mesh.
VoIP	<ol style="list-style-type: none"> [#234460] [eITS#241200677] Voice Fallback IPv6 > IPV4 (in case of a DualStack IPv4v6 interface). [#234456] [eITS#240700831] Carry voice over IPV6
Wireless	<ol style="list-style-type: none"> [#234458] Support of DataElements parameters for ZYXEL One Cloud [#234457] Support of Generic DataElements parameters
TR069	<ol style="list-style-type: none"> [#235111] [eITS#250500686][Eye Networks] WX5600, Request support for TR-181 parameters

● Bug Fixed

Modified Modules	Bug Fixed List
Security	<ol style="list-style-type: none"> [#233854] Fix Device.X_ZYXEL_Change_Icon_Name.Internet_Blocking_Enable
MPro Mesh	<ol style="list-style-type: none"> [#225978] [MPro Mesh][Stress][Time: 3days][Occurs: 1 time]During stress test, it will lead AP/RP_Agent auto config fail then Controller's daemon "p1905_managerd" disappear.
TR-369	<ol style="list-style-type: none"> [#233872] [BUGFIX] hosts with empty value

Modifications in 5.70(ACEB.4.1)b2

● Feature Enhancement

Modified Modules	Features Enhancement List
Lifemote	<ol style="list-style-type: none"> [#233862] [Feature] Lifemote customization parameters for meminfo [#233160] "[Config] Lifemote default controller setting"
System	<ol style="list-style-type: none"> [#233875] [Feature] Parental Control Overnight feature [#233857] [Feature] Timezone Auto Detect
TR369	<ol style="list-style-type: none"> [#233867] [Feature] Bulk data parameter maximum length [#233836] [Enhance] TR369 Certificate
APP	<ol style="list-style-type: none"> [#233842] Zyxel certificate for OneCloud services [#232553] Zyxel one over Wi-Fi OPAL 2.0 RESTful API implementation

● Bug Fixed

Modified Modules	Bug Fixed List
System	<ol style="list-style-type: none"> [#233852] Fix Device.X_ZYXEL_Change_Icon_Name.Internet_Blocking_Enable
TR369	<ol style="list-style-type: none"> [#232749] [MPro Mesh] In TR-369 Local Agent page, the Controller item for cloud information should not be empty. [#233870] [BUGFIX] hosts with empty value
GUI	<ol style="list-style-type: none"> [#232178] [GUI] After key in wrong passord, WEB GUI appear message with wrong color.
Security	<ol style="list-style-type: none"> [#232089] [MTK Project][Vulnerability] Security flaw that allow admin/user to enable debug flag and retrieve root password

Modifications in 5.70(ACEB.4.1)b1

● Feature Enhancement

Modified Modules	Features Enhancement List
GUI	1. [#229972] WEB GUI meets the request of Europe EAA (European Accessibility Act)
APP	1. [#230557] [Feature] FW includes Cloud CA for Zyxel One App
Wireless	1. [#230558] [Feature] Support dataelement for Zyxel Cloud

● Bug Fixed

Modified Modules	Bug Fixed List
Security	1. [#231693] [CVE-2025-20631、CVE-2025-20632、CVE-2025-20633] MediaTek 晶片的 WLAN 驅動程式最新漏洞影響數百萬裝置安全 2. [#229965] EN18031 OPAL20 product compliance release

Modifications in 5.70(ACEB.4)C0

Based on V5.70(ACEB.4)b3 to release V5.70(ACEB.4)C0

● Feature Enhancement

Modified Modules	Features Enhancement List

● Bug Fixed

Modified Modules	Bug Fixed List

Modifications in 5.70(ACEB.4)b3

● Feature Enhancement

Modified Modules	Features Enhancement List
System	1. [#225581] [EN18031][CVE] Fixed CVE
SSH	1. [#225572] [EN18031][SSH] Remove insecure cipher suit for dropbear SSH
GUI	1. [#225564] [EN18031][Log] Add some logs when end users change their profile on GUI

● Bug Fixed

Modified Modules	Bug Fixed List
Wireless	<ol style="list-style-type: none"> 1. [#223599] [eITS#240401316] ZYX-655 WX5600, Connectivity issues after some uptime/idle time 2. [#223596] [eITS#240600991] ZYX-674 EX5601 5GHz wifi driver causes softIRQ 3. [#225978] [MPro Mesh][Stress][Time: 3days][Occurs: 1 time]During stress test, it will lead AP/RP_Agent auto config fail then Controller's daemon "p1905_managerd" disappear. 4. [#225751] [MPro Mesh][Stress][Time: 3days][Occurs: 1 time]During stress test, it will lead AP/RP_Agent auto config fail then Controller's daemon "p1905_managerd" disappear.
Security	<ol style="list-style-type: none"> 1. [#225293] Zyxel-SI-1592 [Vulnerability] Post-authentication command injection vulnerability in the email sending function 2. [#225285] Zyxel-SI-1591 [Vulnerability] Post-authentication command injection vulnerability in the function "ZyEE"

Modifications in 5.70(ACEB.4)b2

● Feature Enhancement

Modified	Features Enhancement List
----------	---------------------------

Modules	
System	1. [#221966] [eITS#240801627] Conditional ROM convert for Guest WiFi password scheme enhancement
Wireless	1. [#221960] [eITS#240600487] Request for support of DataElements parameters
GUI	1. [#220032] Will not force Web http redirect to https.

● Bug Fixed

Modified Modules	Bug Fixed List
Wireless	1. [#220465] [CVE-2024-20017] Improper input validation in wlan service 2. [#221719] [eITS#240900277] Wi-Fi (5GHz) issue 3. [#218476] [eITS#240301064] Broken Steering 4. [#218539] [WLAN] WMM and WMM button don't work properly.
Security	1. [#220464] [CVE-2024-9197] Zyxel-SI-1583 [Vulnerability] Buffer overflow and potential command injection vulnerabilities in VMG3625-T50B (Medium) 2. [#220463] [CVE-2024-8748] [Zyxel-SI-1576] [Vulnerability] Unauthenticated buffer overflow in VMG8825-T50
GUI	1. [#218735] [WLAN] The 5GHz Band list will appear Guest-4 & backhaul SSID in MAC Authentication page
TR369	1. [#218359] [TR369] FW upgrade fail via TR369.
Throughput	1. [#216794] [eITS#240600166] Add parameter to specify number of parallel streams for iPerf tests

Modifications in 5.70(ACEB.4)b1

● Feature Enhancement

Modified	Features Enhancement List
----------	---------------------------

Modules	
System	<ol style="list-style-type: none"> 1. [#216030] [eITS#240600337] DHCP option 43 - ACS information 2. [#215682] [Security][TSA] V.E.4 : Downgrade protection. 3. [#212402] Dual-image support 4. [#215754] Dual-image support 5. [#215750] [Enhance] Open Source Packages Upgrade - Phase I 6. [#211354] [Security] if it is dual image, perform disable JATG/BROM cmd during production with the mtk-efuse-tool, but shipping fw will not included mtk-efuse-tool
WAN	<ol style="list-style-type: none"> 1. [#215811] [eITS#240200611]EX5601, MAP-T issue with s46-portparams
Wireless	<ol style="list-style-type: none"> 1. [#215804] [eITS#240301447] Guest WiFi password scheme enhancement
TR-369	<ol style="list-style-type: none"> 1. [#215611] [eITS#231000272][AXIROS] Certificate management for websocket 2. [#215605] [eITS#230900654][AXIROS] implementation request / WebSocket 3. [#215657] [eITS#231001817] Web GUI configuration for websocket
APP	<ol style="list-style-type: none"> 1. [#215726] [APP] Zyxel One APP implement
GUI	<ol style="list-style-type: none"> 1. [#216035] [eITS#240701741]Add "GPON SN, gateway IP and connection up time for WAN and WLAN client" in system Info page.

● Bug Fixed

Modified Modules	Bug Fixed List
Security	<ol style="list-style-type: none"> 1. [#215797] [Security] SNMP Agent Default Community Name (public, private) 2. [#215762] [Security] SSH Weak Host Key Algorithm 3. [#215756] [Security] change the bm file support TE commend exec diable JTAG/BROM 4. [#211355] [Security] change the bm file support TE

	commend exec diable JTAG/BROM 5. [#215733] [CVE-2024-5412][Zyxel-SI-1557][Vulnerability] Unauthenticated heap buffer overflow in the libclinkc library. 6. [#215744] [CVE-2024-38266, 38267, 38268, 38269][Zyxel-SI-1559] Multiple authenticated buffer overflow vulnerabilities
MPro Mesh	1. [#215690] [MPro Mesh_Agent] When turn off APP LED in Home page icon, Controller LED will dark but all RP_Agent still on.
System	1. 209760] [eITS#240400405]WX5600, factory reset should terminate ssh-session

Modifications in 5.70(ACEB.3.2)C0

Based on V5.70(ACEB.3.2)b1 to release V5.70(ACEB.3.2)C0

● Feature Enhancement

Modified Modules	Features Enhancement List

● Bug Fixed

Modified Modules	Bug Fixed List

Modifications in 5.70(ACEB.3.2)b1

● Feature Enhancement

Modified Modules	Features Enhancement List
GUI	1. [#213662] [eITS#240600745] Rejecting firmware due to WebGUI https CA handling and http shut down decision

● Bug Fixed

Modified Modules	Bug Fixed List
Security	1. [#213693] [CVE-2024-38266, 38267, 38268, 38269][Zyxel-SI-1559] Multiple authenticated buffer overflow vulnerabilities
TR-069	1. [#213137] [eITS#240600934][Eye Networks] WX5600, TR069 communication issue with authentication, see 240501006

● Pending

Modified Modules	Pending List

● Not a problem

Modified Modules	Not a problem List

Modifications in 5.70(ACEB.3.1)C0

Based on V5.70(ACEB.3.1)b1 to release V5.70(ACEB.3.1)C0

● Feature Enhancement

Modified Modules	Features Enhancement List

● Bug Fixed

Modified Modules	Bug Fixed List

Modifications in 5.70(ACEB.3.1)b1

● Feature Enhancement

Modified Modules	Features Enhancement List

● Bug Fixed

Modified Modules	Bug Fixed List
Security	1. [#211356] [Security] change the bm file support TE commend exec diable JTAG/BROM 2. [#211612] [CVE-2024-5412][Zyxel-SI-1557][Vulnerability] Unauthenticated heap buffer overflow in the libclinkc library.
TR-069	1. [#211686] [eITS#240400570][HIPER] TR069 process dies

● Pending

Modified Modules	Pending List

● Not a problem

Modified Modules	Not a problem List

Modifications in 5.70(ACEB.3)C0

Based on V5.70(ACEB.3)b5 to release V5.70(ACEB.3)C0

● Feature Enhancement

Modified	Features Enhancement List
----------	---------------------------

Modules	

- **Bug Fixed**

Modified Modules	Bug Fixed List

Modifications in 5.70(ACEB.3)b5

- **Feature Enhancement**

Modified Modules	Features Enhancement List
MPro Mesh	1. [#209634] [MPro Mesh_Agent] When turn off APP LED in Home page icon, RP_Agent will be still on

- **Bug Fixed**

Modified Modules	Bug Fixed List
MPro Mesh	1. [#208354] [eITS#240101619][Eye Networks] WX5600, SSID not synchronized correctly in mesh where 2.4GHz radio is disabled

- **Pending**

Modified Modules	Pending List

- **Not a problem**

Modified Modules	Not a problem List

Modifications in 5.70(ACEB.3)b4

● Feature Enhancement

Modified Modules	Features Enhancement List
System	1. [#208143] MFG/TE fw boot time optimization (開機時間優化) 2. [#208978] Support new flash 11-544-000043Z (MX35LF4GE4AD-Z4I,MXIC)

● Bug Fixed

Modified Modules	Bug Fixed List
TR-369	1. [#208274] [TR369] When the user upgrades the FW from 2C0 to 3b3 via GUI and without reset, GUI display not normally and check TR369 page will pop message.
TR-069	1. [#208357] [eITS#240200784]Valenet -GPN Device.WiFi. fail

● Pending

Modified Modules	Pending List

● Not a problem

Modified Modules	Not a problem List

Modifications in 5.70(ACEB.3)b3

● Feature Enhancement

Modified Modules	Features Enhancement List

MPro Mesh	1. [#197909] [eITS#230300767]EX5601, MProMesh App feature request to include guest isolation level
-----------	--

● Bug Fixed

Modified Modules	Bug Fixed List
TR-369	1. [#200986] [TR-369] WebSocket via CLI to connect AXESS4 Server ,CPE will offline server
GUI	1. [#203391] [GUI] Please remove 802.11/b/g/n/ax/be Mixed option 2. [#201167] [GUI] By default mesh enabled, 5G the wireless button is available in wireless page.
Security	1. [#204915] [CVE-2024-0816][Zyxel-SI-1536] [Vulnerability] Buffer overflow vulnerability in the "traceroute" command
MProMesh	1. [#195525] [eITS#230800043]WX5600, MProMesh APP showing router icon for a WX5600 controller

● Pending

Modified Modules	Pending List

● Not a problem

Modified Modules	Not a problem List
WAN	1. [#205734] [eITS#231200465][Eye Networks] EX5501 + OPAL family, Feature improvement request - WAN ip lease time
System	1. [#205740] [eITS#231200276]Backup config file encryption

Modifications in 5.70(ACEB.3)b2

● Feature Enhancement

Modified Modules	Features Enhancement List
MPro Mesh	1. [#202275] [eITS#231000006]ZYX-593 IoT SSID (FRQ to propagate 3 parameters from the controller to the agents)
TR069	1. [#202164] [eITS#230901028][Eye Networks] WX5600-T0, How to use STUN and why UDPConnectionRequestAddress is empty

● Bug Fixed

Modified Modules	Bug Fixed List
System	<ol style="list-style-type: none"> [#200589] [System] Login default admin account and click skip button,the Password Reset page would keep loading. [#200493] [System] User account Web Privilege are same as the administrator account.
Document	1. [#200469] [DST] The default setting file doesn't match GUI config.
GUI	<ol style="list-style-type: none"> [#201168] [GUI] Disable mesh and onessid, wifi page pop clients number error message [#200125] [System] [GUI] WLAN Others page support 6G selection.
TR069	1. [#201577] [eITS#231100480]WX5600-T0 / No XMPP Connection Attempt
IGMP	1. [#195544] [eITS#230500422]EX5601, Multicast over mesh wifi
MPro Mesh	<ol style="list-style-type: none"> [#200220] [MPro Mesh] APC do FW update from last GA fw to test beta fw , RP_agent can't re-connect normally. [#199851] [MPro Mesh_Agent] When disable non mesh GW WAN, Controller didn't change Internet Status to "No Internet Connection". [#199831] [MPro Mesh_Agent] When disable controller's MESH, APP should not to login. [#201231] [MPro Mesh] RP_agent(layer2) didn't re-connect when disble Controller 2.4g main WIFI. [#200634] [eITS#230701406][Eye Networks] WX5600, Auto

	controller mode, controller state recovery bug
--	--

● **Pending**

Modified Modules	Pending List

● **Not a problem**

Modified Modules	Not a problem List
	1.

Modifications in 5.70(ACEB.3)b1

● **Feature Enhancement**

Modified Modules	Features Enhancement List
LED	1. [#168406] WX5600-T0 Disable/Enable LEDs
Wireless	1. [#192400] [eITS#230601279][Eye Networks] WX5600 generic support for 1+5 2. [#196297] OCAC enhancement based on CE regulation 3. [#197909] [eITS#230300767]EX5601, MProMesh App feature request to include guest isolation level 4. [#197918] [eITS#230600450][Elisa] EX5601 Wireless Network Max clients
TR369	1. [#197912] [wilhelm.tel] DX3301 must be support TR369
System	1. [#197914] [System] Wish description Protected Management Frames want to abbreviation, should change to PMF not show Protected MGMT Frames. 2. [#198071] disable console pin via software 3. [#198744] upgrade OpenSSL to 3.1.2 4. [#199715] Upgrade curl to 8.4.0

GUI	1. [#198190] OPAL Generic Reboot GUI
Security	1. [#198055] [Security] Header Security Test 2. [#198049] [Security] Outdated Software 3. [#197917] [Security] Session/Cookie Security Test 4. [#197916] [Security] Setting Up the Password Strength 5. [#197915] [Security] Unauthenticated Access to APIs 6. [#197913] [CVE-2011-5053][Zyxel-SI-1498][Vulnerability] WPS vulnerability on CPE in WLAN 7. [#199675] [CVE-2023-37929][Zyxel-SI-1506][Vulnerability] Post-authentication buffer overflow.
IGMP	1. [#197919] [eITS#230500277][Eye Networks] EX5601, CLI cfg command to IGMP snooping

● Bug Fixed

Modified Modules	Bug Fixed List
TR069	1. [#199426] [eITS#230901035][Eye Networks] WX5600, IPv6/IPv4 issue
Wireless	1. [#192444] [eITS#230300715]ZYX-548 WX5600, Some iPads fail to reconnect to MESH after sleep mode. 2. [#195544] [eITS#230500422]EX5601, Multicast over mesh wifi

● Pending

Modified Modules	Pending List

● Not a problem

Modified Modules	Not a problem List

Modifications in 5.70(ACEB.2)C0

Based on V5.70(ACEB.2)b5 to release V5.70(ACEB.2)C0

● Feature Enhancement

Modified Modules	Features Enhancement List

● Bug Fixed

Modified Modules	Bug Fixed List

Modifications in 5.70(ACEB.2)b5

● Feature Enhancement

Modified Modules	Features Enhancement List

● Bug Fixed

Modified Modules	Bug Fixed List
MPro Mesh	1. [#195974] [MPro Mesh] [Stress] [Time: 3days] Shielding room B Multy Pro stress test environment, during 3days stress AP_Agent will continuously fail to ping Gateway.

Modifications in 5.70(ACEB.2)b4

● Feature Enhancement

Modified Modules	Features Enhancement List

● Bug Fixed

Modified Modules	Bug Fixed List
IPTV	1. [#190189] [eITS#230500420] [MPro Mesh] The IPTV (Multicast) will stop playing after 4~5 mins if it's under WX5600_RP.

Modifications in 5.70(ACEB.2)b3

● Feature Enhancement

Modified Modules	Features Enhancement List
System	1. [#184736] [eITS#220301182] add possibility periodically reboot CPE using standard scheduler
TR-069	1. [#190010] [eITS#230500482] WX5600, Support for TR-069 configurable Energy-Efficient Ethernet(EEE)
MPro Mesh_APP	1. [#184516] [eITS#230201046] WX5600, MProMesh APP user login after controller has changed, see ticket: 220700305

● Bug Fixed

Modified Modules	Bug Fixed List
TR-069	1. [#184920] [eITS#230201161] WX5600, enable/disable SSH via ACS, recover the wrong setting with coustomer configuration
WPS	1. [#188378] [eITS#230300395] ZYX-527 WX5600, WPS from first repeater hop

Modifications in 5.70(ACEB.2)b2

● Feature Enhancement

Modified Modules	Features Enhancement List
------------------	---------------------------

System	<ol style="list-style-type: none"> 1. [#188533][eITS#220701153]EX5601, Wifi retransmission counters 2. [#188531][System][220701077] OPAL, Feature proposal/request - Soft-Reset feature
GUI	<ol style="list-style-type: none"> 1. [#184767][GUI] Compact help link adding ito GUI
WLAN	<ol style="list-style-type: none"> 1. [#188536][eITS#230100596] EX5601, SSID naming logic when disabling mesh and allowing separate SSIDs
MPro Mesh	<ol style="list-style-type: none"> 1. [#188537][eITS#230101291] EX5601, Disabling Mesh does not bring down the backhaul, which is still broadcasted as a hidden SSID 2. [#188532][eITS#221101418]OPAL, Partial factory reset option with firmware upgrades. (tr069/gui) 220701077
TR-098	<ol style="list-style-type: none"> 1. [#183724][eITS#230200423]WX5600-T0 TR-098 support for WiFi X_ZYXEL_CountryCode

● Bug Fixed

Modified Modules	Bug Fixed List
XMPP	<ol style="list-style-type: none"> 1. [#180052][eITS#221200471] ZYX-491 WX5600, XMPP doesn't work
System	<ol style="list-style-type: none"> 1. [#185766][System] WX5600 should support syslog over TLS/DTLS. 2. [#184803][eITS#220900371]NTP Time Server URL cannot support "-" 3. [#184920][eITS#230201161]WX5600, enable/disable SSH via ACS 4. [#188539][eITS#230300429]EX5601, certificate Common Name doesn't match host name 5. [#184816][eITS#230100138]rom-d backup
GUI	<ol style="list-style-type: none"> 1. [#188538][eITS#230300494]EX3301, GUI menu visible prior to login 2. [#188535][eITS#220901550]Translation error WIFI password strength
TR-069	<ol style="list-style-type: none"> 1. [#188540][eITS#230301653]EX5601, CurrentTime not reporting in accordance to the TR-069 standard

Modifications in 5.70(ACEB.2)b1

● Feature Enhancement

Modified Modules	Features Enhancement List
System	<ol style="list-style-type: none"> [#182250][ETSI EN 303 645] 5.8-2: The confidentiality of sensitive personal data communicated between the device and associated services shall be protected, with cryptography appropriate to the properties of the technology and usage [#182242][ETSI EN 303 645] The consumer IoT device shall protect the confidentiality of critical security parameters that are communicated via remotely accessible network interfaces [#182231][ETSI EN 303 645] 5.3-2: When the device is not a constrained device, it shall have an update mechanism for the secure installation of updates.
WPS	<ol style="list-style-type: none"> [eITs#210900469][#184734][OPAL Generic]Change WPS button trigger condition
WLAN	<ol style="list-style-type: none"> [eITs#220900539][#180899]WX5600-T0 supports the UNII-3 band
MPro Mesh	<ol style="list-style-type: none"> [eITs#221001326][#176387]WX5600, Limited use of LED indications while using Auto-controller
GUI	<ol style="list-style-type: none"> [#184835]Support Web http redirect to https.
APP	<ol style="list-style-type: none"> [#184216][OPAL Regular]support APP 3.0

● Bug Fixed

Modified Modules	Bug Fixed List
Throughput	<ol style="list-style-type: none"> [eITs#221101318][#183973][DX5401]Very low Guest WiFi throughput.
System	<ol style="list-style-type: none"> [eITs#230200872][#184356]EX5601/WX5600, cfg wifi_easy_mesh

	edit 2. [eITs#230100130][#181783]WX5600, ifconfig has eth0 and eth1 mixed up 3. [eITs#221201010][#180740]WX5600, romd backup include option 12 and 125 devices specific option value 4. [eITs#230101372][#184576]WX5600, time lag
WLAN	1. [eITs#220200828][#184658]Wi-Fi Password - Special characters
TR-069	2. [eITs#220401035][#183349][TR-069] SPV WiFi BeaconType failed
GUI	1. [#184755][OPAL Generic]GUI translation_ES_NL 2. [#184664][GUI] Some words contain "@@" when the language is Dutch or Türkçe.
System	1. [#184251][CVE-2022-4203,4304,4450][CVE-2023-0215~0217,0286,0401][Zyxel-SI-1464][Vulnerability]OpenSSL multiple vulnerabilities

Modifications in 5.70(ACEB.1)C0

Based on V5.70(ACEB.1)b3 to release V5.70(ACEB.1)C0

● Feature Enhancement

Modified Modules	Features Enhancement List

● Bug Fixed

Modified Modules	Bug Fixed List

Modifications in 5.70(ACEB.1)b3

● Feature Enhancement

Modified Modules	Features Enhancement List
WLAN	1. [eITs#220901662][#178383]WX5600, Configurable WiFi Country Code (ISO 3166-1 alpha-2)
Wireless	1. [eITs#220900760][#174768]WX5600, iwpriv stacountinfo

	value formatting bug
--	----------------------

● Bug Fixed

Modified Modules	Bug Fixed List

Modifications in 5.70(ACEB.1)b2

● Feature Enhancement

Modified Modules	Features Enhancement List
System	1. [#177404]Zyxel-SI-1433 [Vulnerability] Buffer overflow vulnerabilities and command injection vulnerability

● Bug Fixed

Modified Modules	Bug Fixed List
GUI	1. [eITS#221000390][#175273]Typo on GUI interface's pop-up warning window
MPro Mesh	1. [eITS#221000993][#176416]OPAL, Partial reset feature from ticket 220701077 should keep Mesh auto controller configuration

Modifications in 5.70(ACEB.1)b1

● Feature Enhancement

Modified Modules	Features Enhancement List
System	1. [eITS#220800762][#171997]WX5600, Lifemote improvements
MPro Mesh	1. [eITS#220701197][#173444]WX5600, Feature Request/Proposal: Cabled controller AP to create backhaul interface for itself when building a mesh 2. [eITS#220800634][#173825]WX5600-T0 support with EX5401-B0/1

	3. [#173810]Auto Role
WPS	1. [#172275]Intuitive WPS handling (Client/Mesh pairing)

● Bug Fixed

Modified Modules	Bug Fixed List
System	1. [eITS#220900244][#173745]EX5601, boot-pw
WLAN	1. [#172397][WLAN]After CPE reboot, wifi client connect guest wifi will fail.
MPro Mesh	1. [#167254][MPro Mesh] Shielding room B Multy Pro stress test environment, during stress test it will cause Controller and RP_Agent reboot@skb_panic

Modifications in 5.70(ACEB.0)C0

Based on V5.70(ACEB.0)b5 to release V5.70(ACEB.0)C0

● Feature Enhancement

Modified Modules	Features Enhancement List

● Bug Fixed

Modified Modules	Bug Fixed List

Modifications in 5.70(ACEB.0)b5

● Feature Enhancement

Modified Modules	Features Enhancement List

● Bug Fixed

Modified Modules	Bug Fixed List
------------------	----------------

Modules	
System	<ol style="list-style-type: none"> [#169892][System] PS not match CPE. [#169801]WX5600, device gets no IP after reboot
MPro Mesh	<ol style="list-style-type: none"> [#165449][MPro Mesh] Using Candela to simulate 32* 2.4G & 32* 5G wifi clients associate/ disassociate stress test, after one day stress Mesh Topology information disappeared and RP_Agent cannot connect back to Controller again.

Modifications in 5.70(ACEB.0)b4

● Feature Enhancement

Modified Modules	Features Enhancement List

● Bug Fixed

Modified Modules	Bug Fixed List
System	<ol style="list-style-type: none"> [#164780][System] After a whlie, the CPE console will appear error message continuously after get IP address from PQA LAB
Throughput	<ol style="list-style-type: none"> [#167126][Throughput] Use IxChariot test ASUS wifi client to WX5600-T0 Lan port 2.5G+2.5G via 40 Pairs, throughput value does not pass PQA criterion.
MPro Mesh	<ol style="list-style-type: none"> [#168157][MPro Mesh] 1905 daemon socket not connected, all Agent information can't see in Mesh topology table but APP can get all Agent information [#168059][MPro Mesh] All agent does not transmit guest beacon after Controller enable guest WiFi and all agent sync successfully.

Modifications in 5.70(ACEB.0)b3

● Feature Enhancement

Modified	Features Enhancement List
----------	---------------------------

Modules	

● Bug Fixed

Modified Modules	Bug Fixed List
MPro Mesh	<ol style="list-style-type: none"> 1. [#167184][MPro Mesh] When client connected guest wifi, it should can playing youtube streaming 2. [#166942][MPro Mesh] All Agent power LED always keep twinkling and signal LED is off after disable Controller 5G main WiFi and then enable. 3. [#166929][MPro Mesh] WPS button press 2 times of WPS button within 8 seconds, no action is triggered when Repeater Mode. 4. [#166794][MPro Mesh] Still encounter a wait time of more than 5 minutes during the test steering 5. [#166793][MPro Mesh] Backhaul optimization cannot work.
MPro Mesh_Agent	<ol style="list-style-type: none"> 1. [#167137][MPro Mesh_Agent] Controller's WPS LED always keep twinkling when APP to do add extender process but did not to press extender WPS HW button 2. [#166856][MPro Mesh_Agent] After reboot controller, all Agent power LED always keep twinkling 3. [#166853][MPro Mesh_Agent] APP can't see second layer Agent information
WLAN	<ol style="list-style-type: none"> 1. [#166899][WLAN] When GW wifi security Level with no security change to more secure, CPE use AP list to connect to GW again will fail.

Modifications in 5.70(ACEB.0)b2

● Feature Enhancement

Modified Modules	Features Enhancement List

● Bug Fixed

Modified Modules	Bug Fixed List
System	<ol style="list-style-type: none"> [#164911][System] The WX5600-T0 Wi-Fi LED are not blinking when WX5600-T0 LAN PC run speedtest throughput via RP mode [#164907][System] The WX5600-T0 WPS LED will keep blinking even WPS connection successful with gateway [#164904][System] The Backhual Link Quality LED are always off (WX5600-T0) [#164585][System] The LAN side link rate show incorrect info between LAN host NIC & CPE GUI [#164576][System] The DUT_B will change to DUT_A setting after use ExpressBoot tool to upload config to rom-d (Account & Password & SSID & Preshared Key MUST can NOT be change) [#164562][System] CPE will accept non WX5600-T0 configuration file via GUI
PS	<ol style="list-style-type: none"> [#164870][PS] The value are not corresponding between GUI & PS document
DST	<ol style="list-style-type: none"> [#164379][DST] The GUI default setting did not match DST
Wireless	<ol style="list-style-type: none"> [#165238][Wireless] Some wireless throughput value are low.
MPro Mesh	<ol style="list-style-type: none"> [#165198][MPro Mesh] Test AP roaming when the controller will steer RP2 to the controller 5G backhaul [#165197][MPro Mesh] Band Steering and AP roaming, Because the information is too busy, "zyslctl -a / -l" cannot display information. [#164671][MPro Mesh] All agents disconnect from Controller when Idle over-night(over 14hrs). [#164601][MPro Mesh] Modify WX5600 main and guest SSID/password severial times, it cause daemon "p1905_managerd" and "mapd" disappear. (Rate: 1/7) [#164501][MPro Mesh] WiFi LED does not blinking when Client playing Youtube video streaming. [#164493][MPro Mesh] Backhaul PreSharedKey is always the

	<p>same one and too short after Controller each reset to default.</p> <p>7. [#164489][MPro Mesh] Backhual Link Quality LED is always off</p> <p>8. [#164472][MPro Mesh] RP_agent will connect back to Controller after RP_agent reset to default and reboot successfully.</p> <p>9. [#164470][MPro Mesh] WPS LED color is Green not Amber.</p> <p>10. [#164448][MPro Mesh] Extender WPS LED keep blinking about 2 mins after pairing successful.</p>
MPro Mesh_Agent	<p>1. [#165038][MPro Mesh_Agent] In APP Devices page, did not see any End Devices information.</p> <p>2. [#165035][MPro Mesh_Agent] APP did not see any Agent information at Home page.</p> <p>3. [#165029][MPro Mesh_Agent] Use APP to do add Extender function does not work.</p>
Stress	<p>1. [#165124][Stress] After 69 hours, clients will fewer connections (46 -> 29).</p>
WLAN	<p>1. [#165108][WLAN] AP List can't connect to gateway with no security.</p> <p>2. [#164909][WLAN] Go to AP list page, the first click rescan button, DUT will happen call trace, but DUT not reboot.</p> <p>3. [#164639][WLAN] CPE should can set fixed channel</p> <p>4. [#164407][WLAN] Wifi client connect WX5600, WLAN Station Status will not show client information.</p>
MGMT	<p>1. [#164800][MGMT] The CPE will accept setting by TR-181 method even CPE default datamodel is TR-098</p>
TR-069	<p>1. [#164681][TR-069] CPE can't download firmware successfully by TR-069 method</p>

Modifications in 5.70(ACEB.0)b1

● Feature Enhancement

Modified Modules	Features Enhancement List
------------------	---------------------------

--	--

● Bug Fixed

Modified Modules	Bug Fixed List